

030-00109



Pin 1

030-00107



Pin 1



030-00104




Pin 1

QTY	Ref	Item Number	Description
12'	1	025-00046	WIRE,PVC 18AWG 300V TWSTD,O/P
13.5'	2	025-00099	WIRE,PVC 18AWG 300V TWSTD,
65'	3	025-00057	WIRE,TWSTD,18AWG,O/V BLK/JACKET
126'	4	W100134P	CABLE,18/2 R/B GRAY JKT 105C
19	C1	030-00109	Plug,8PIN, 5.08mm,BLK/ORG
16	C2	030-00104	Plug,2PIN, 2.08mm,BLK/ORG
4	C3	030-00107	Plug,4PIN, 5.08mm, BLK/ORG
1	P1	062-00189	PWRSPPLY,24V,96W
1	P2	062-00189	PWRSPPLY,24V,96W
1.25'		800118	WIRE,PVC 18AWG 300VSTR VIOLET
184		030-00112	BULK,FERRULE,.75/14MM WHT
2		030-00113	TWIN,FERRULE,.75/19MM WHT

Cable specification [length (cable reference)]

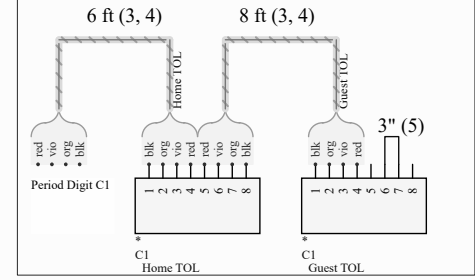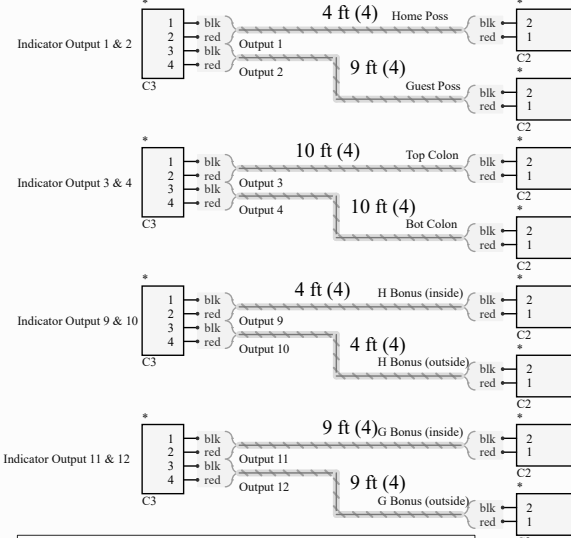

Revision Control
 A. Add optional TOL. Must remove remove 3" p/n 800118 from Period Digit p/n 030-00109. Install optional TOL to Period Digit p/n 030-00109.
 B. Add cross over power cable for second power supply

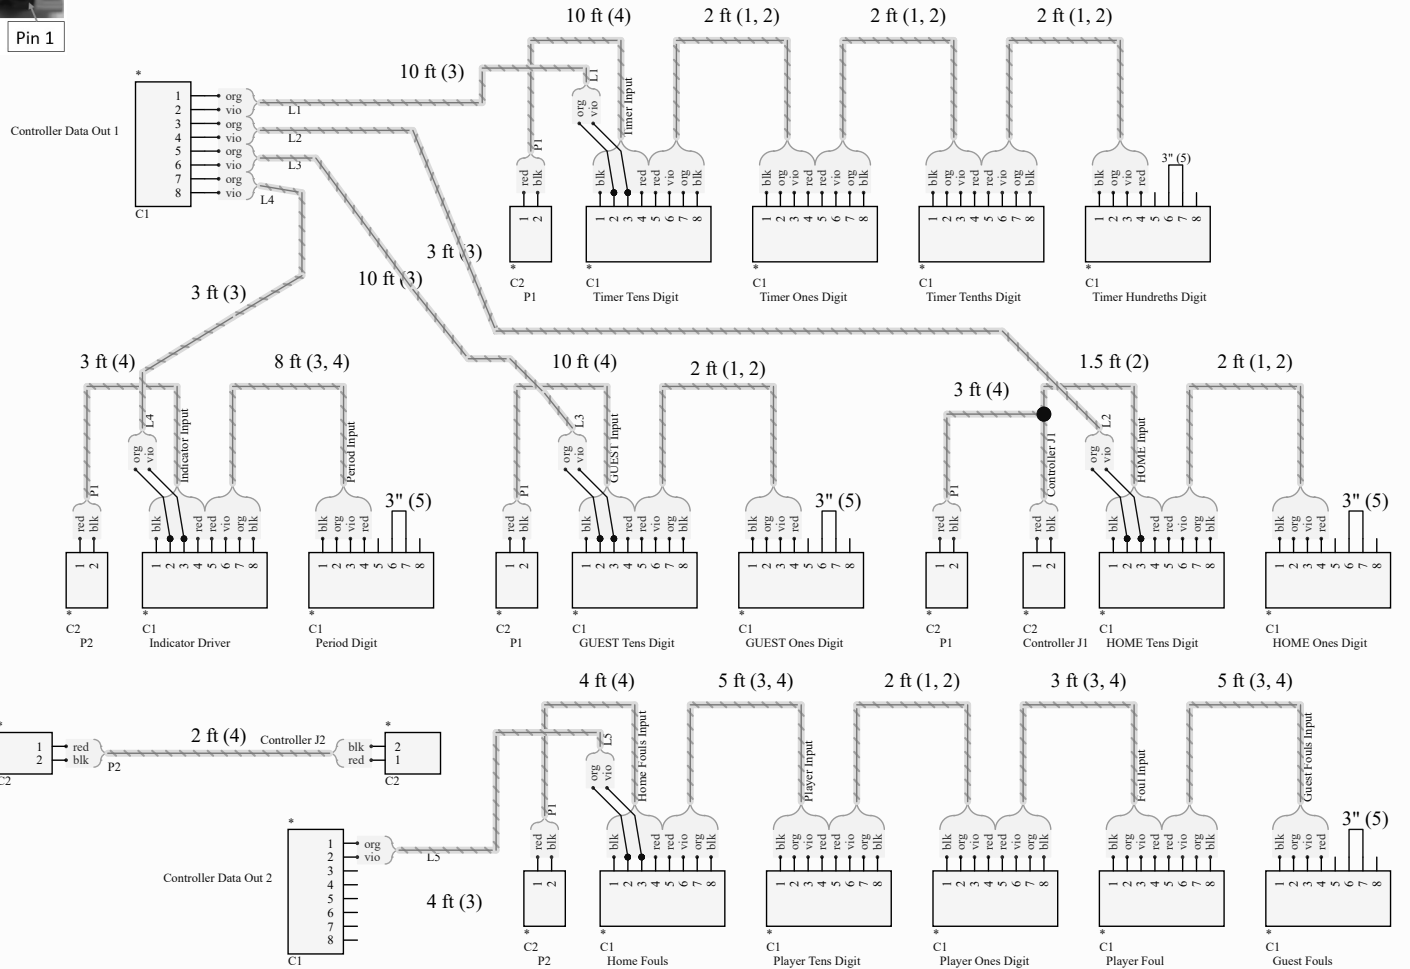

- Instructions
1. Cut the cable (refer to the reference number) to length. Label each end.
 2. Crimp ferrule, 030-00112 to the ends of each cable wire.
 3. Crimp ferrule, 030-00113 to specified wires.
 4. Insert wire into connectors (C1, C2, C3) according to pinout.
 5. If build requires Time Out Left(TOL), build TOL harness and install on Period Digit C1.
 6. If build doesn't require TOL, do not build TOL harness.

Title * BK9106(TOL) Harnesses